NS0-191^{Q&As}

NetApp Certified Support Engineer

Pass Network Appliance NS0-191 Exam with 100% Guarantee

Free Download Real Questions & Answers **PDF** and **VCE** file from:

https://www.geekcert.com/ns0-191.html

100% Passing Guarantee
100% Money Back Assurance

Following Questions and Answers are all new published by Network Appliance Official Exam Center

Instant Download After Purchase

100% Money Back Guarantee

365 Days Free Update

800,000+ Satisfied Customers

QUESTION 1

A customer has replaced both interconnect cables on a FAS3240 HA pair with IOXM because they were damaged. After replacing the cables, the customer receives the error shown below.

"HA interconnect port 1 of this appliance seems to be connected to port 2 on the partner appliance".

In this scenario what is the cause of this error?

A. The interconnect cables must not be replaced while the controllers are up and running.

B. c0a and c0b are 10Gbit Ethernet ports which must not be used for the interconnect.

C. The interconnects are cross-cabled, you must connect c0awith c0a and cob with c0b.

D. You must issue theifconfig down... command followed by theifconfig up... command for both ports, on both controllers, after replacing the cables.

Correct Answer: C

QUESTION 2

Click the Exhibit tab.

vserver	volume	size	state	type	available	max-autosize	min-autosize	autosize	language
myvserver	source	150MB	online	RW	142.4MB	180MB	150MB	true	C

They create the following destination volume

vserver	volume	size	state	type	available	max-autosize	min-autosize	autosize	language
mydrvserver	destination	150MB	online	RW	142.4MB	200MB	150MB	true	EN

A customer is attempting to protect the source volume listed in the exhibit. They try to initialize a DP mirror relationship to the destination volume but it will not initialize as expected. Which two settings on the destination volume are causing this problem? (Choose two.)

A. language

B. type

C. volume size

D. max-autosize

Correct Answer: BD

QUESTION 3

A customer has one storage virtual machine (SVM) that is using Fibre Channel as a protocol (FCP). Some clients are successfully accessing LUNs on this SVM. The zoning is done by using worldwide port names (WWPNs). The customer creates a second SVM for Fibre Channel and wants to access new LUNs in this SVM from the same clients.
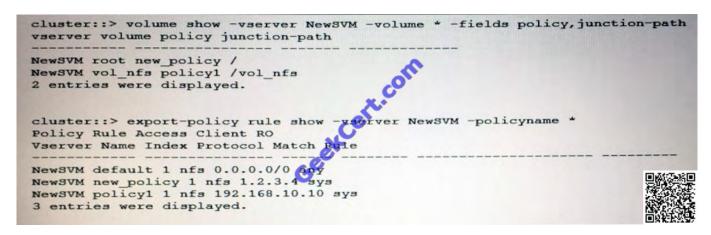
Which three statements are true in this scenario? (Choose three.)

A. The initiator groups (igroups) from the first SVM are also working for the second SVM.

B. Fibre Channel zoning must be reconfigured for the new SVM.

C. FCP must be enabled on the second SVM.

D. Fibre Channel zoning does not need to be changed if the second SVM uses the same ports as the first SVM.

E. You must map the new LUNs in the second SVM to the correct initiator group (igroup).

Correct Answer: ABC

QUESTION 4

Click the Exhibit tab.


```
cluster::> volume show -vserver NewSVM -volume * -fields policy,junction-path
vserver volume policy junction-path
---------- ---------------- -------- ---------------
NewSVM root new_policy /
NewSVM vol_nfs policy1 /vol_nfs
2 entries were displayed.

cluster::> export-policy rule show -vserver NewSVM -policyname *
Policy Rule Access Client RO
Vserver Name Index Protocol Match Rule
---------- ---------------- ------- -------- ---------------------- ---------
NewSVM default 1 nfs 0.0.0.0/0 any
NewSVM new_policy 1 nfs 1.2.3.4 sys
NewSVM policy1 1 nfs 192.168.10.10 sys
3 entries were displayed.
```

The customer configured an SVM called "NewSVM" for NFS, configured the volume, "vol_nfs", mounted at "/vol_nfs", and set up NFSv3 as shown in the exhibit. However, if they try to mount from the client with IP address 192.168.10.10, they receive a "permission denied" error.

In this scenario, which action will solve the error condition?

A. Add a rule to the defaultexport policy to include the-clientmatch 192.168.10.0/24parameter.

B. Stop and start NewSVM.

C. Associate a correct export policy to the root volume (/) of NewSVM.

D. Configure the default route for NewSVM correctly.

Correct Answer: B

QUESTION 5

A customer mentions that after replacing a failed power supply, their FAS2220 system is now unavailable. Which statement is correct in this scenario?

A. The FAS2220 system requires that the power supplyis replaced within two minutes after removal.

B. The power supply is not hot-swappable on a FAS2220.

C. The FAS2220 system requires both power supplies properly functioning to serve data.

D. The FAS2220 system shut down after 15 minutes due to having onlyone power supply installed.

Correct Answer: C

To Read the Whole Q&As, please purchase the Complete Version from Our website.

Try our product !

100% Guaranteed Success
100% Money Back Guarantee
365 Days Free Update
Instant Download After Purchase
24x7 Customer Support
Average 99.9% Success Rate
More than 800,000 Satisfied Customers Worldwide
Multi-Platform capabilities - Windows, Mac, Android, iPhone, iPod, iPad, Kindle

We provide exam PDF and VCE of Cisco, Microsoft, IBM, CompTIA, Oracle and other IT Certifications. You can view Vendor list of All Certification Exams offered:

https://www.geekcert.com/allproducts

Need Help

Please provide as much detail as possible so we can best assist you.
To update a previously submitted ticket: