

# HP2-T25<sup>Q&As</sup>

Servicing HP Rack-Tower Server Solutions

# Pass HP HP2-T25 Exam with 100% Guarantee

Free Download Real Questions & Answers PDF and VCE file from:

https://www.geekcert.com/HP2-T25.html

100% Passing Guarantee 100% Money Back Assurance

Following Questions and Answers are all new published by HP Official Exam Center

- Instant Download After Purchase
- 100% Money Back Guarantee
- 365 Days Free Update
- 800,000+ Satisfied Customers



2021 Latest geekcert HP2-T25 PDF and VCE dumps Download

#### **QUESTION 1**

What is the best way to exercise replaced DAS components in a server?

- A. Run HP Insight Diagnostics online, selecting Diagnose.
- B. Run ADU.
- C. Run the hard disk test in BIOS.
- D. Run HP Insight Diagnostics offline, selecting Custom Test.

Correct Answer: D

\* (not A) Using the Test tab (HP Insight Diagnostics Offline Edition only) \*




Note: direct attached storage (DAS) References:

#### **QUESTION 2**

A support engineer is attending a call out for a DL360P Gen8 Server, where a hard disk within a four disk RAID 5 set has failed. The engineer notices that on three of the drives, the LED labeled D on the exhibit is on.

What does the condition indicate?

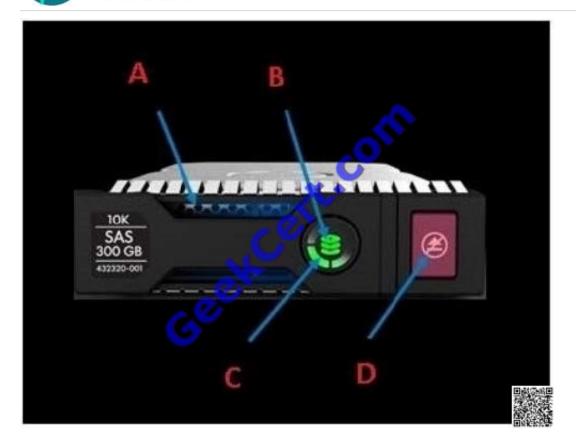


A. Hot swapping of the failed drive is not supported in this condition.

- B. The LED indicates both failure and predictive failure alerts; therefore, two additional drives in the RAID set are at risk of failing and need to be replaced.
- C. The drive failure has corrupted three drives in the RAID set. The array will need to be rebuilt and data restored from backup.
- D. Do not remove the drives with this LED on.

Correct Answer: D

Drive LED definitions

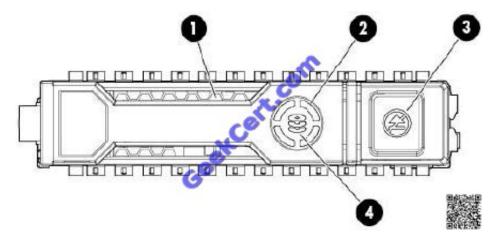

<sup>\*</sup> Do not remove / Solid white Do not remove the drive. Removing the drive causes one or more of the logical drives to



fail. / Off Removing the drive does not cause a logical drive to fail.


### **QUESTION 3**

Match the correct UPS description with each picture.

Hot Area:



2021 Latest geekcert HP2-T25 PDF and VCE dumps Download

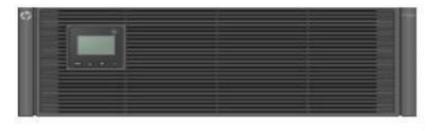

R7000	
RP36000/3	
R8000/3	
R/T2200 G2	
R1500 G3	
R5500	
T1000 G3	



R7000 RP36000/3 R8000/3 R/T2200 G2 R1500 G3 R5500 T1000 G3



R7000	
RP36000/3	3
R8000/3	
R/T2200 G	2
R1500 G3	
R5500	
T1000 G3	





Hot Area:



2021 Latest geekcert HP2-T25 PDF and VCE dumps Download



R7000	
RP36000/3	
R8000/3	
R/T2200 G2	2
R1500 G3	
R5500	
T1000 G3	



R7000 RP36000/3 R8000/3 R/T2200 G2 R1500 G3





R7000	
	-
RP36000/3	
R8000/3	-
R/T2200 G2	
R1500 G3	
R5500	
T1000 G3	



Correct Answer:



2021 Latest geekcert HP2-T25 PDF and VCE dumps Download



R7000	
RP36000/3	
R8000/3	
R/T2200 G2	2
R1500 G3	
R5500	
T1000 G3	



R7000 RP36000/3 R8000/3 R/T2200 G2 R1500 G3 R5500 N1000 G3



R7000	
RP36000/3	
R8000/3	
R/T2200 G2	ij.
R1500 G3	
R5500	
T1000 G3	



R7000	- 6
RP36000/3	
R8000/3	
R/T2200 G2	
R1500 G3	
R5500	
T1000 G3	



#### **QUESTION 4**

What is the first step when creating a NIC team using NCU?

- A. Select team members.
- B. Configure the team IP address.
- C. Set IP of each NIC to be used in the team.
- D. Choose team type.


Correct Answer: A

1.

The HP Network Configuration Utility Properties window will look like the one provided below.

2.

Select 2 NICs by clicking on it and then click Team button.

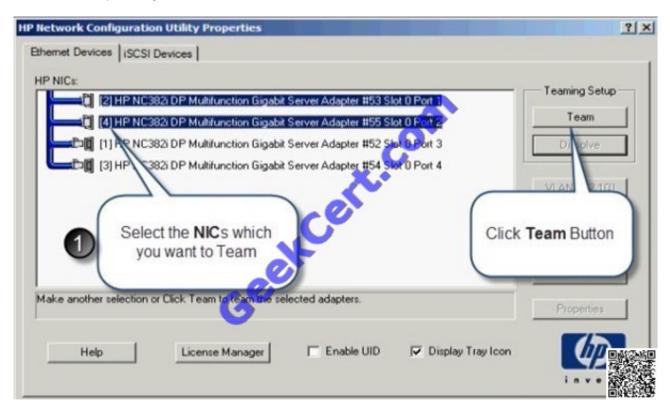

Note:

\*

NIC Teaming (Network Teaming) means you are grouping two or more physical NICs and it will act as a single NIC. You may call it as a Virtual NIC. Minimum number of NICs which can be grouped (Teamed) is Two and the maximum



2021 Latest geekcert HP2-T25 PDF and VCE dumps Download

number of NICs which you can group is Eight.

To create NIC Teaming in Windows 2008/2003 Operating System, we need to use the HP Network Configuration Utility (NCU).

#### **QUESTION 5**

A customer has an HP Integrity rx2800 i2 server with one processor and two memory risers, each with four DIMMs. The customer added an additional memory riser with four memory DIMMs, but cannot see the additional memory at the

operating system level. The customer already swapped the first memory riser with the new one, but there is no change.

What could cause this issue?

- A. One of the new DIMMs is faulty.
- B. The new memory riser is faulty.
- C. An additional license is needed for using more than two memory risers.
- D. An additional processor is needed for using more than two memory risers.

Correct Answer: C

\*The DIMMs are partitioned by the number of processors installed in the server. If you have only one processor installed in the system, you can only use 12 of the 24 memory slots. \*

# Table 10 Memory Load Order

	2 Processor system (socket 0 and 1)		1 Processor system (socket 0)	
Pair number	Memory expansion board	Memory slots	Memory expansion board	Memory slots
1	Memory expansion board 1	3A and 4A	Memory expansion board 1	3A and 4A
2	Memory expansion board 3	3A and 4A	Memory expansion board 2	3A and 4A
3	Memory expansion board 2	3A and 4A	Memory expansion board 1	1B and 6B
4	Memory expansion board 4	3A and 4A	Memory expansion board 2	1B and 6B
5	Memory expansion board 1	1B and 6B	Memory expansion board 1	2C and 5C
6	Memory expansion board 3	1B and 6B	Memory expansion board 2	2C and 5C
7	Memory expansion board 2	1B and 6B	-	-
8	Memory expansion board 4	1B and 6B	-	
9	Memory expansion board 1	2C and 5C	-	_ 
10	Memory expansion board 3	2C and 5C	_	- 8

**HP2-T25 PDF Dumps** 

HP2-T25 VCE Dumps

**HP2-T25 Braindumps** 

2021 Latest geekcert HP2-T25 PDF and VCE dumps Download

To Read the Whole Q&As, please purchase the Complete Version from Our website.

# Try our product!

100% Guaranteed Success

100% Money Back Guarantee

365 Days Free Update

**Instant Download After Purchase** 

24x7 Customer Support

Average 99.9% Success Rate

More than 800,000 Satisfied Customers Worldwide

Multi-Platform capabilities - Windows, Mac, Android, iPhone, iPod, iPad, Kindle

We provide exam PDF and VCE of Cisco, Microsoft, IBM, CompTIA, Oracle and other IT Certifications. You can view Vendor list of All Certification Exams offered:

https://www.geekcert.com/allproducts

# **Need Help**

Please provide as much detail as possible so we can best assist you. To update a previously submitted ticket:





Any charges made through this site will appear as Global Simulators Limited.

All trademarks are the property of their respective owners.

Copyright © geekcert, All Rights Reserved.